

AHT Liftgates, LLC

309 Mogie Ln. Acworth, Ga. 30102 (770) 425-5480

E-Mail: parts@ahtliftgates.com Web: www.ahtliftgates.com

STEEL TROUBLESHOOTING GUIDE

PROBLEM	CAUSE	CORRECTION
PLATFORM	1) In winter, it is normal	- Can try lower 10 viscosity oil
LOWERS SLOW	2) Flow control valve is	- Flow control valve is on the block opposite the C30 cartridge valves. Loosen
	closed or adjusted wrong	nut and turn valve stem counter clockwise. Retighten nut.
	3) Lift arm pins are seized	- Lubricate all 12 points. Check operator's manual for locations. Most books page 21
PLATFORM RAISES SLOW	1) Low current to motor	- Charge battery and check for poor ground.
	2) Low hydraulic oil	- Put platform on ground. Check oil level. Add new oil to within 1" from top of tank.
	3) Flow control valve is closed or adjusted wrong	- Flow control valve is on the block opposite the C30 cartridge valves. Loosen nut and turn valve stem counter clockwise. Retighten nut.
	4) Suction Filter is plugged	- Drain oil from hydraulic tank and check & clean filter
	5) Lift arm pins are seized	- Lubricate all 12 points. Check operator's manual for locations. Most books page 21